


Gori[®] propeller

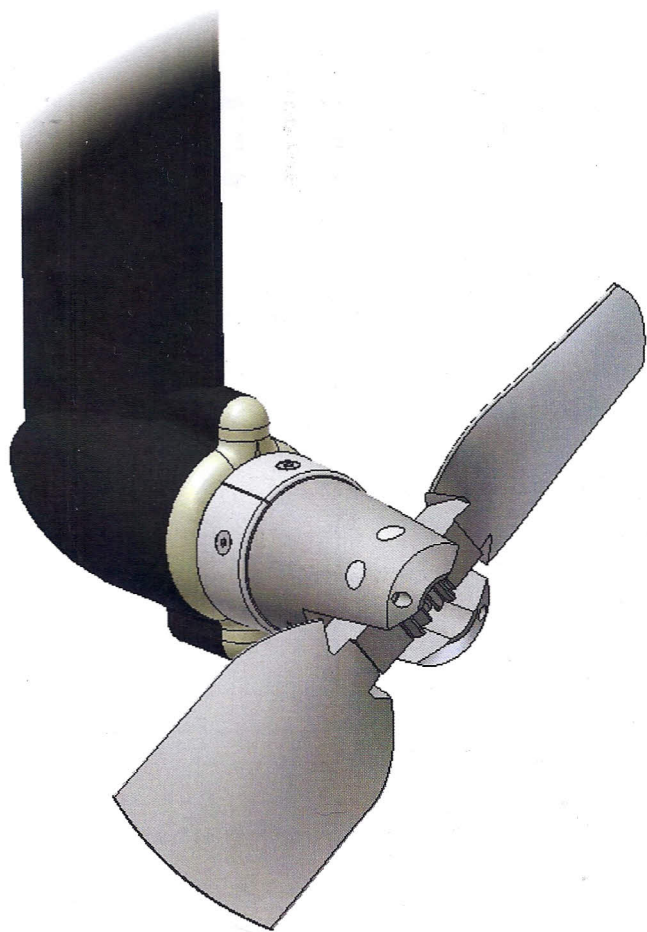

DK

Læs instruktionen før der arbejdes med propellen.

Vigtigt!

Uskift zink hvis de er korroderet mere end 50 %.

Advarsel!

Pas på skarpe kanter.

GB

Read the Instructions before any work on the propeller.

Important!

Replace zinc if eroded more than 50%.

Warning!

Beware of sharp edges.

D

Bitte die Anweisung lesen, bevor Sie mit dem Propeller arbeiten.

Wichtig!

Zinkteile auswechseln, wenn sie mehr als 50% korrodiert sind.

Warnung!

Achten Sie auf die scharfe Kanten.

F

Lire les instructions avant toute intervention sur l'hélice

Important!

Remplacer l'anode zinc si elle est corrodée à plus de 50%

Attention!

Attention aux bords coupants

IT

Leggere attentamente le Istruzioni prima di qualsiasi operazione sull'elica.

Importante!

Sostituire l'anodo di zinco se usurato più del 50%

Avvertenza!

Prestare attenzione alle parti taglienti

ESP








Lea las intrucciones antes de efectuar cualquier trabajo en la hélice.








¡ Importante !








Reemplazar el ánodo si observa mas de un 50 % de corrosión.







¡ Advertencia !


Tenga cuidado con las esquinas afiladas.

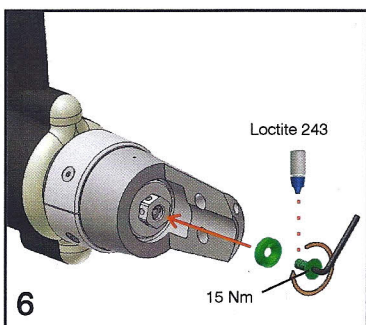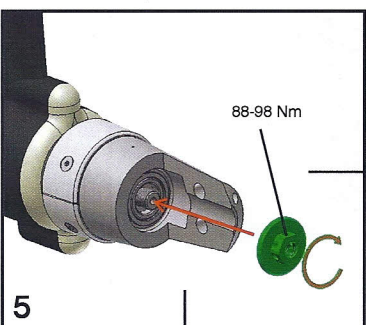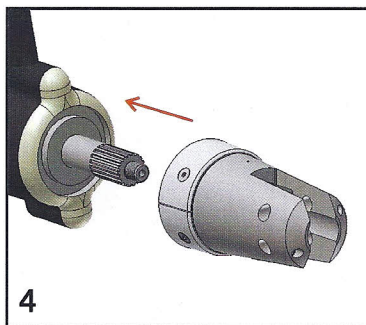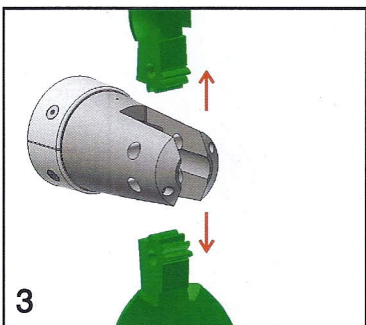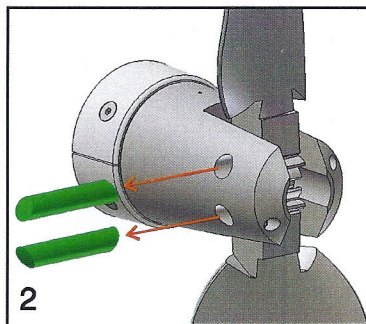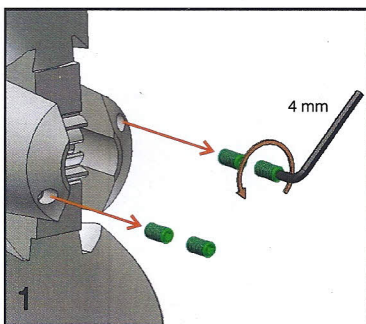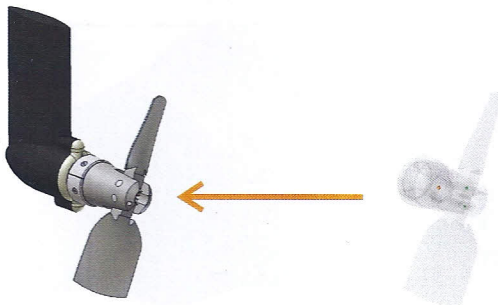

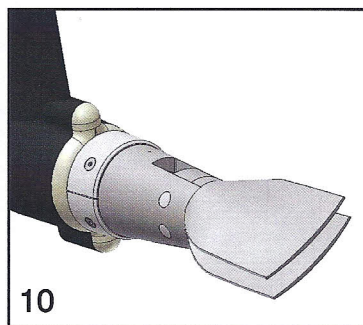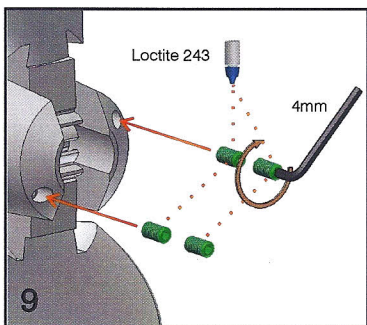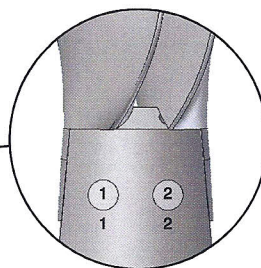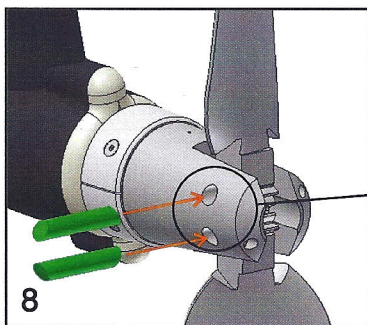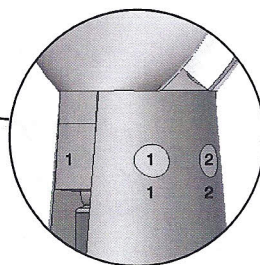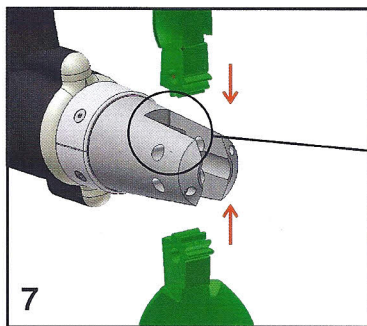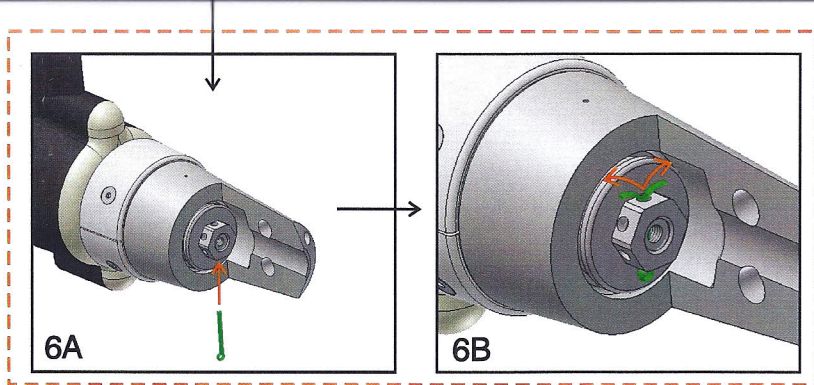

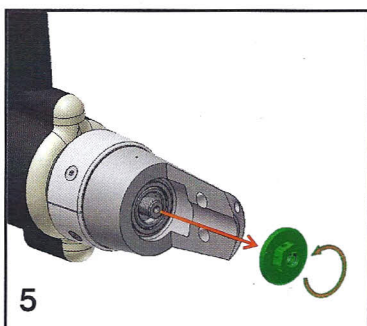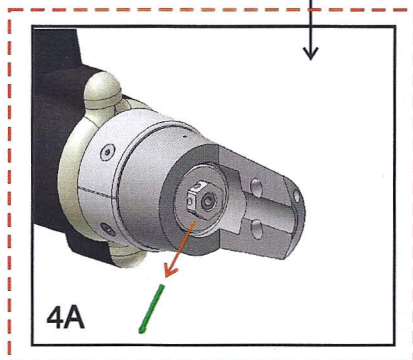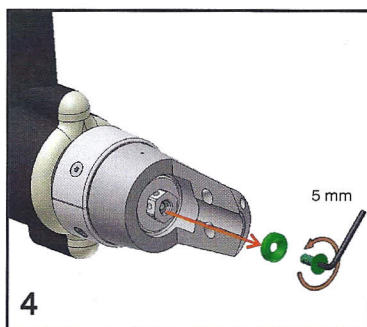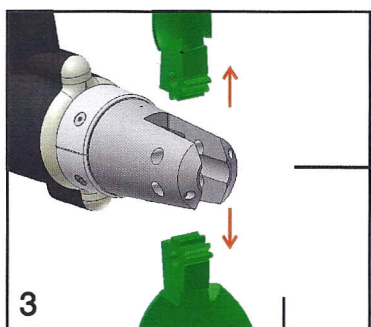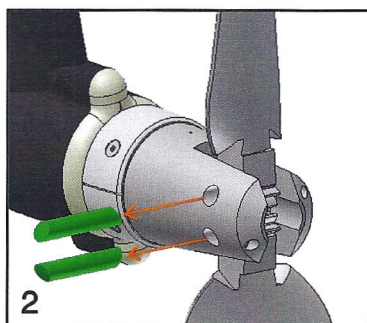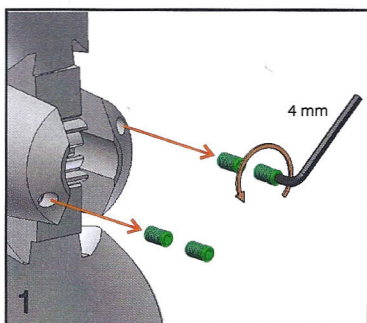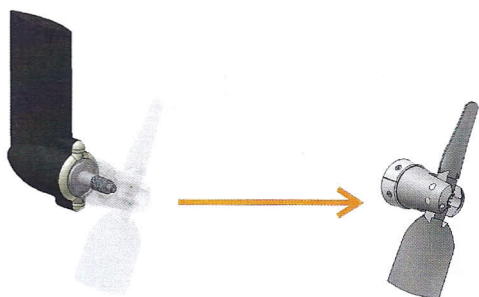

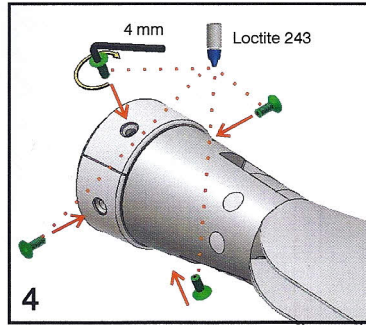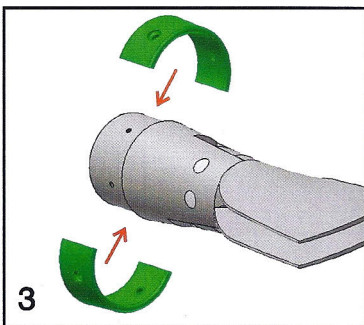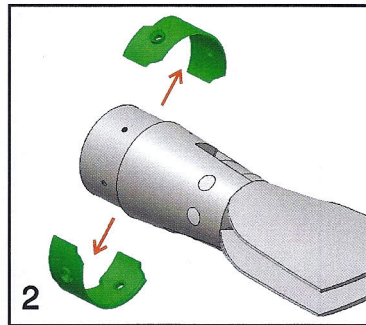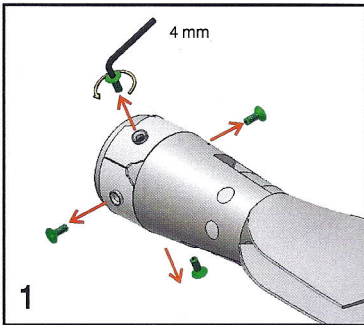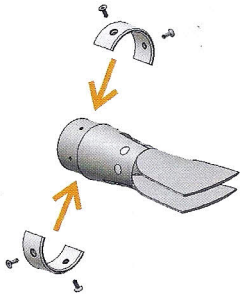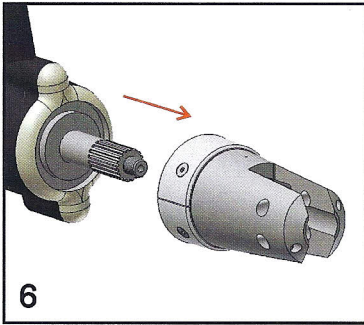

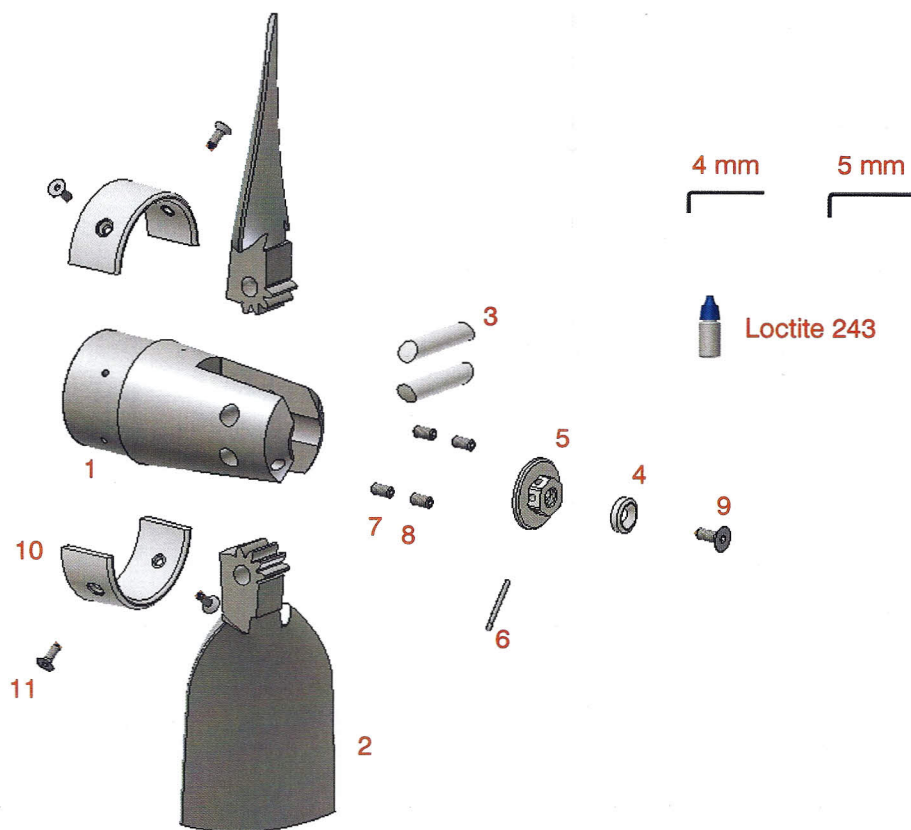

	DK	GB	D	F	IT	ESP	Pcs.
1	Nav	Hub	Nabe	Moyeu	Mozzo	Cuerpo	1
2	Blad	Blade	Flügel	Pales	Pale	Pala	2
3	Aksel	Pin	Führungsstifte	Boulons en acier	Perni-pale	Pasador	2
4	Låseskive	Lock Washer	Sicherungsscheibe	Rondelle frein	Rondella-sicurezza	Tuerca de seguridad	1
5	Møtrik	Nut	Mutter	Ecrou	Dado	Arandela	1
6	Split	Split pin	Splint	Goupille fendue	Coppiglia	Chaveta	1
7	Skrue M8	Screw M8	Schrauben M8	Vis M8	Grano di fermo M8	Tornillo M8	2
8	Skrue M8	Screw M8	Schrauben M8	Vis M8	Grano di fermo M8	Tornillo M8	2
9	Skrue M8	Screw M8	Schrauben M8	Vis M8	Vite-bloccaggio M8	Tornillo M8	1
10	Zink	Zinc	Zink	Anode zinc	Anodo zinco	Ánodo	2
11	Skrue M8	Screw M8	Schrauben M8	Vis M8	Vite M8	Tornillo M8	4

TECHNOSERVICE
marine engineers
PO. Box 169 - 1230 AD LOOSDRECHT
info@klapschroef.nl
t: 035 5827195 - f: 0842 244462



DET NORSKE VERITAS MANAGEMENT SYSTEM CERTIFICATE

Certificate No. 16177-2004-AQ-ARG-DANAK

This is to certify that

Steel Team A/S & Gori Propeller A/S

Lysbjergvej 11, DK-6500 Vojens, Denmark

has been found to conform to the Management System Standard:

DS/EN ISO 9001:2000

This Certificate is valid for the following product or service range:

**High-tech Manufacture of High Precision CNC Machined
Components for the Automotive, Aerospace, Wind Energy,
Hydraulic and the Commercial Marketplace.
Manufacture, Sales and Services of Gori Propeller
for Sailboats and of Special Machinery.**

This Certificate is valid until:
2010-09-30

Place and date:

Helsingør, 2007-10-19

for the Certification Organ. to:
**DET NORSKE VERITAS, DANMARK A/S
CERTIFICATJEN**



Certification audit has been performed by

**ib A. Jensen
Lead Auditor**

**Jens Peter Holst
Management Representative**

Lack of fulfillment of conditions as set out in the Certification Agreement may render this Certificate invalid.

Det Norske Veritas, Denmark A/S, Certificatjen, Tøndervej 11, DK-2800 Lyngby, Denmark. Tel: +45 39 16 10 00 www.dnv.com

**Gori®
propeller**

Steel Team A/S
Lysbjergvej 11, Hammelev
DK-6500 Vojens

Phone : +45 73 52 53 54
Fax : +45 73 52 53 55
www.gori-propeller.dk